

| | | | |
|------------|-------------|----------|---|
| Report ID: | 28,302,743 | Version: | 1 |
| Created: | 04 Jul 2026 | | |


| | | | |
|---------------|-------------|------------------|-------------------|
| Make: | Mazda | Model: | Premacy |
| Body Style: | SUV | Year: | 2009 |
| Rego No.: | MHE701 | Rego Expiry: | 08 Feb 2027 |
| WoF Expiry: | 16 Dec 2026 | Odometer: | 204,982 Kms |
| Good No.: | 28302743 | VIN: | 7AT0C133X19335448 |
| Next Service: | 199600 | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

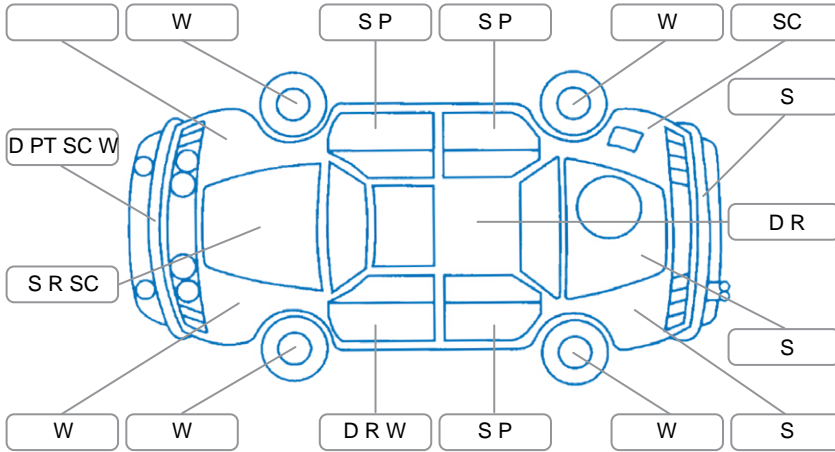

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

- Windscreen cracked
- Right auto sliding not operating
- Front bumper misaligned
- Poor paint repairs

Conditions During Body Inspection: Wet Dry

Under Carriage and Under Bonnet Inspection Comments

- Engine oil leak
- Underbody surface rust

Interior Comments

| | |
|------------|---------|
| Seats: | Average |
| Carpets: | Average |
| Panels: | Average |
| Dashboard: | Average |

General Comments

- Flat remote keys
- Check engine light displayed
- Poor brake performance
- Knock in steering and suspension

| | | | |
|-----------------------------------|------------------------------|-----------------------------|-----|
| Road Conditions During Test Drive | Dry | | |
| Engine Timing Mechanism | Timing Chain | | |
| Evidence of Cam Belt Replacement | <input type="checkbox"/> Yes | <input type="checkbox"/> No | Kms |
| Inspected by: | Sione Mae | | |
| Published by: | Sione Mae | | |
| Inspection Date: | 04 Jul 2026 | | |

| | OK | Requires Attention | N/A |
|-----------------------------------------------------|----|--------------------|------|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Engine performance | ✓ | | |
| Noise | ✓ | | |
| Coolant condition | ✓ | | |
| Cooling performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | | ✓ | |
| Hand brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | | | 3 mm |
| Right front | | | 4 mm |
| Left rear | | | 5 mm |
| Right rear | | | 6 mm |
| Spare | | Yes | |
| Suspension | | | |
| Suspension performance | | ✓ | |
| Steering performance | | ✓ | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | | ✓ | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | | ✓ | |
| Sat. nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

I have read and understood this condition guide:

NAME _____

SIGNATURE _____