

Report ID:	28,314,528	Version:	2
Created:	18 Jul 2026		


Make:	Mazda	Model:	Familia
Body Style:	Sedan	Year:	1995
Rego No.:	ZO4727	Rego Expiry:	15 Nov 2026
WoF Expiry:	20 Nov 2026	Odometer:	170,012 Kms
Good No.:	28314528	VIN:	7A8C10H0700200054
Next Service:	166,000km's	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

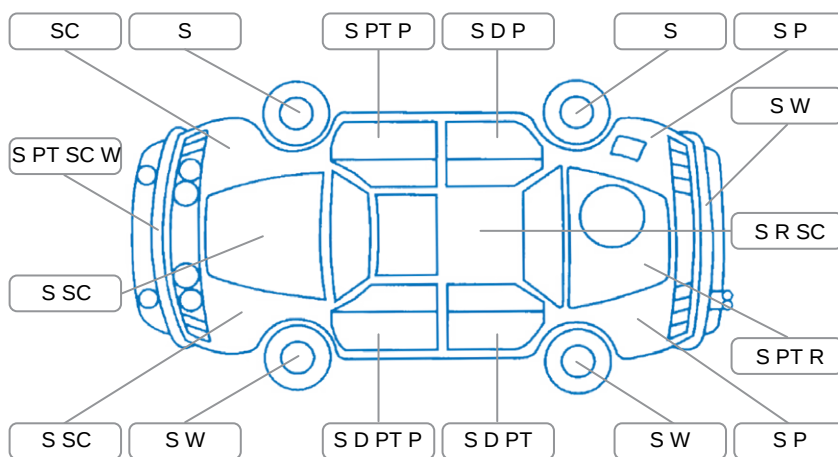

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Left side wing mirror housing not secured in place & has a crack in mirror surround trim.
Left side of rear boot spoiler is not secured down to boot lid.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Oil leaks from engine.

Interior Comments

Seats:	Good
Carpets:	Poor
Panels:	Average
Dashboard:	Average

General Comments

Engine oil service overdue. Switch for wing mirrors is only working in one direction & left side will not retract with switch. Holes worn in carpet in right front foot well area.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☒ Yes ☐ No 98,293 Kms
Inspected by:	Jason Young
Published by:	Jason Young
Inspection Date:	09 Jul 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints		✓	
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.6 mm
Right front			5.6 mm
Left rear			5.6 mm
Right rear			5.6 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____