


Make:	Mazda	Model:	MPV
Body Style:	SUV	Year:	2005
Rego No.:	GKB497	Rego Expiry:	12 Sep 2026
WoF Expiry:	18 Dec 2026	Odometer:	322,729 Kms
Good No.:	28315527	VIN:	7AT0C11EX12446909
Next Service:	313,000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

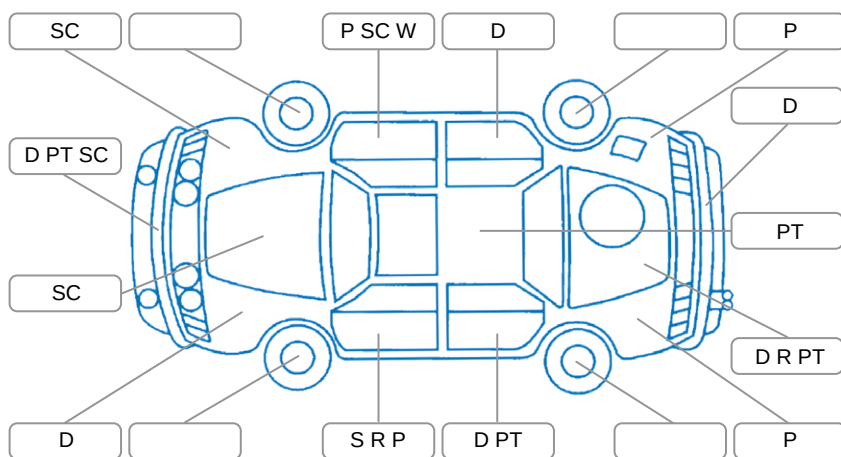

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Drivers inside door handle broken. Passenger window not closing correctly. Stone chips windscreen. Left side skirt missing.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Low oil. No coolant to inspect. Trans leak.
Front tyres shoulder wear

Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Average
Dashboard:	Average

General Comments

Visors flop. Power doors n/w. Second row right seatbelt stretched.

Play in steering. Engine whine. Engine temperature gauge n/w. Gauges backlighting dim.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Samuel Weir
Published by:	Desian Robb
Inspection Date:	09 Jul 2026

Report ID:	28,315,527	Version:	1
Created:	14 Jul 2026		

	OK	Requires Attention	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			1.5 mm
Right front			2.0 mm
Left rear			5.5 mm
Right rear			3.0 mm
Spare		No	
Suspension			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking		✓	
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____