


Make:	Mazda	Model:	Axela
Body Style:	Hatchback	Year:	2005
Rego No.:	GPZ281	Rego Expiry:	31 Aug 2026
WoF Expiry:	11 Oct 2026	Odometer:	216,572 Kms
Good No.:	28318518	VIN:	7AT0C13JX12207395
Next Service:	no record	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

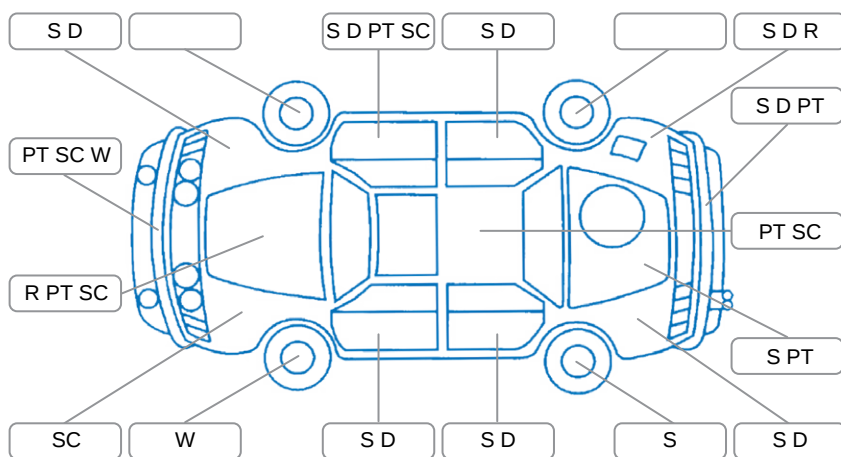

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Aerial stork is broken. Eater leaking in boot. Left rear window monsoon visor is broken.

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Weeping from around translation main seals. Minor surface rust under body.

Interior Comments

Seats:	Right rear seat belt buckle cover is cracked.
Carpets:	Right front is worn, torn.
Panels:	Average
Dashboard:	Crack in middle.

General Comments

Can not operate right rear window from main switch. Squeaking noise from front (steering rack bushes?) Steering wheel audio switch is not connected to aftermarket head unit.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Yuki Itohara
Published by:	Glen Charlton
Inspection Date:	15 Jul 2026

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____

Report ID:	28,318,518	Version:	3
Created:	23 Jul 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.5 mm
Right front			5.0 mm
Left rear			2.5 mm
Right rear			3.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		