

Report ID:	28,333,327	Version:	1
Created:	21 Jul 2026		


Make:	Toyota	Model:	Estima
Body Style:	Wagon	Year:	2004
Rego No.:	KFR411	Rego Expiry:	24 Aug 2026
WoF Expiry:	03 Jun 2027	Odometer:	293,418 Kms
Good No.:	28333327	VIN:	7AT0H61YX16284640
Next Service:	245,000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

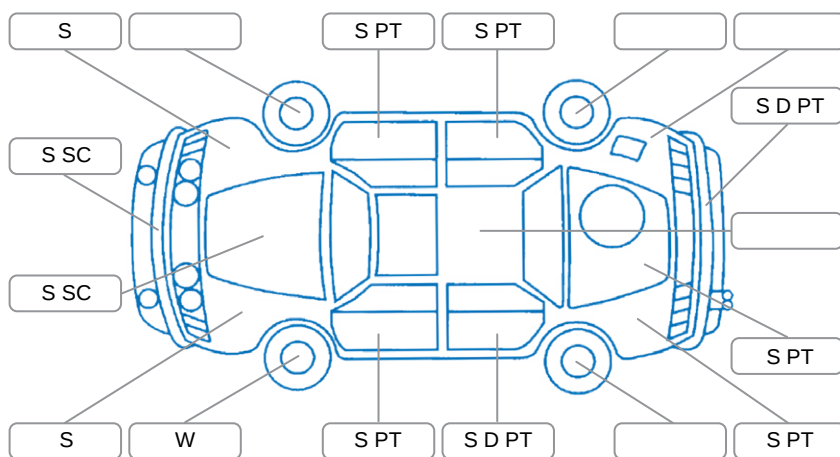

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Vehicle has ben painted white outside -inner door frames are silver
RF monsoon shield broken

Conditions During Body Inspection

Under Carriage and Under Bonnet Inspection Comments

Battery missing positive bolt for terminal
Battery clamp missing
Engine oil leak
Both outer cv boots split

Interior Comments

Seats: most seats stained
Carpets: Average
Panels: Average
Dashboard: Average

General Comments

Steering wheel trim worn
Gear shifter trim broken
Both rear doors hard to open and electric motors don't open or close doors properly
Radio not working, no spare wheel

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	☐ Yes	☐ No	Kms
Inspected by:	Kyle Kelly		
Published by:	Miroslav Granich		
Inspection Date:	21 Jul 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.4 mm
Right front			3.4 mm
Left rear			6.3 mm
Right rear			5.4 mm
Spare		No	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____