

Report ID:	28,337,108	Version:	2
Created:	21 Jul 2026		


Make:	Subaru	Model:	Impreza
Body Style:	Hatchback	Year:	2007
Rego No.:	MUN34	Rego Expiry:	25 Jul 2026
WoF Expiry:	09 Dec 2026	Odometer:	133,750 Kms
Good No.:	28337108	VIN:	7AT0GF09X20004162
Next Service:	136659	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

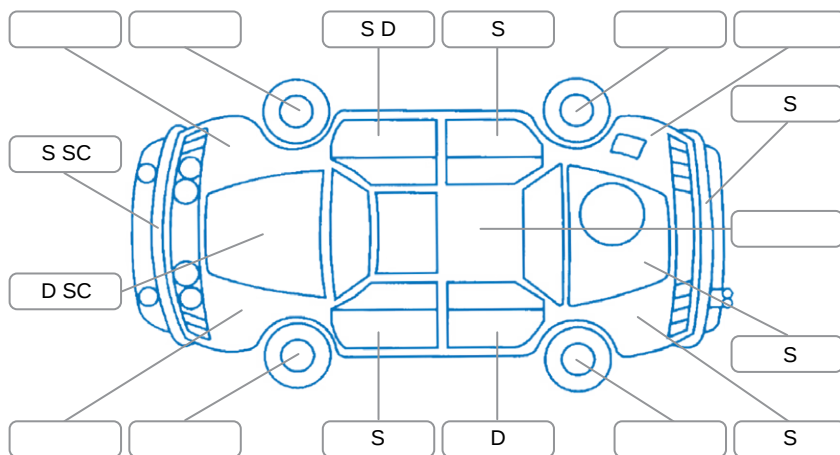

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Rear wiper is split.
Moisture inside left rear inner tail light.
Right front corner of the bumper is not secure.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Play left front wheel side to side movement.
Both lower control arm rear bushes are no good.
Passenger side rocker cover is starting to leak engine oil.
Engine oil at the bottom of the oil filter.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Check engine light is on.
Air conditioning is not blowing cold.
Power steering pump is noisy.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☒ Yes ☐ No 100,000 Kms
Inspected by:	Bryce Steele
Published by:	Bryce Steele
Inspection Date:	21 Jul 2026

	OK	Requires Attention	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Engine performance		✓	
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4 mm
Right front			5 mm
Left rear			7 mm
Right rear			7 mm
Spare		Yes	
Suspension			
Suspension performance		✓	
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)	✓		
Reversing camera	✓		

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____