


Make:	Toyota	Model:	Hilux
Body Style:	Utility	Year:	2011
Rego No.:	FWG959	Rego Expiry:	
WoF Expiry:	18 Nov 2025	Odometer:	193,616 Kms
Good No.:	28359497	VIN:	MR0FZ22G801045060
Next Service:	OVERDUE	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

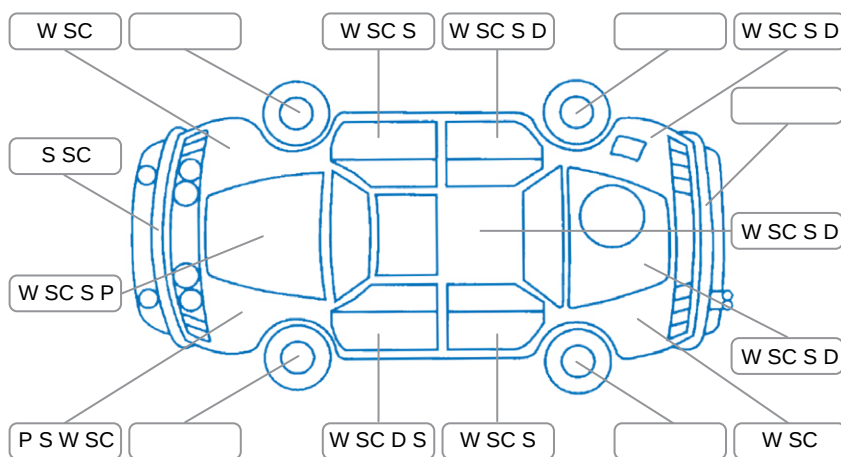

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Scratches, stone chips, dents, rust, paint defects.

Body has been lifted as well as suspension lifted (will require certification)

The licence for this vehicle is temporarily exempt. Vehicle canopy missing brackets / fixing and door panel

Conditions During Body Inspection

Dry

Under Carriage and Under Bonnet Inspection Comments

Rh inner cv boot split and leaking grease.

Towel wrapped around gas tank.

Surface rust on chassis.

Oil on minimum. Water only as coolant

Interior Comments

Seats: Average

Carpets: Average

Panels: Average

Dashboard: Average

General Comments

No registration or wof so didn't drive on the road so multiple items can't be checked so will obviously have to fail.

Number plate lights nw.

Suspension lifted.

Road Conditions During Test Drive

Dry

Engine Timing Mechanism

Cambelt

Evidence of Cam Belt Replacement

☒ Yes

☐ No

143,000 Kms

Inspected by: Gary Adams

Published by: Amanda Loader

Inspection Date: 28 Jul 2026

Report ID:	28,359,497	Version:	4
Created:	17 Sep 2026		

	OK	Requires Attention	N/A
Engine			
Oil level		✓	
Smoke & fumes		✓	
Engine performance		✓	
Noise	✓		
Coolant condition		✓	
Cooling performance		✓	
Radiator / Hoses (visual)		✓	
Transmission			
Operation		✓	
Noise		✓	
Clutch	✓		
CV joints		✓	
Wheel bearings		✓	
Brakes			
Performance		✓	
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.0 mm
Right front			3.0 mm
Left rear			3.0 mm
Right rear			10.0 mm
Spare		Yes	
Suspension			
Suspension performance		✓	
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____