

Report ID:	28,389,322	Version:	1
Created:	11 Aug 2026		


Make:	Mitsubishi	Model:	Galant
Body Style:	Sedan	Year:	2007
Rego No.:	MAA233	Rego Expiry:	13 Jun 2026
WoF Expiry:	23 Jun 2026	Odometer:	212,880 Kms
Good No.:	28389322	VIN:	7AT0CJ0JX19107634
Next Service:	195000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

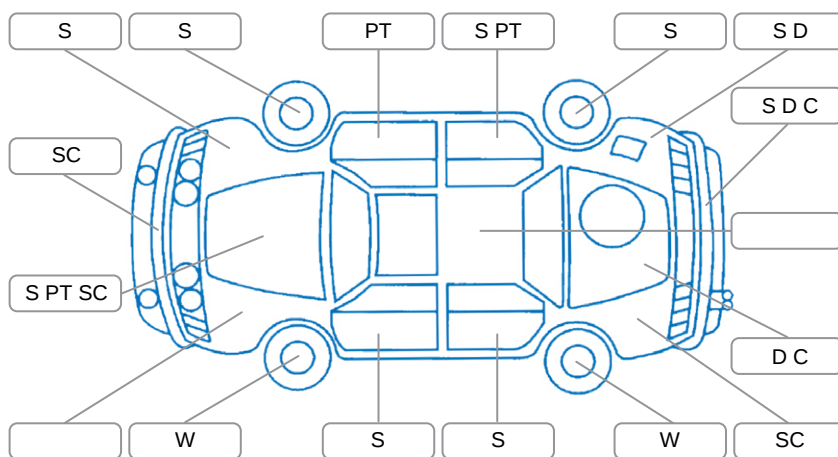

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

L sunshade mirror cover missing,FR seat torn,both front and rear center seat belt damaged,FR side carpet torn,FR door seal torn,both wing mirror folding faulty,FB damage ,antenna damaged,tailgate bent,RL interior door panel torn,

Conditions During Body Inspection	Wet
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

engine oil leaking,steering pump oil leak,FL shock oil leak,both front wheel play,

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Service overdue ,

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Curshey Accad
Published by:	Curshey Accad
Inspection Date:	11 Aug 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			7 mm
Right front			7 mm
Left rear			6 mm
Right rear			6 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers		✓	
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____