

Report ID:	28,406,153	Version:	2
Created:	22 Aug 2026		


Make:	Holden	Model:	Colorado
Body Style:	Utility	Year:	2019
Rego No.:	RZW509	Rego Expiry:	29 Sep 2026
WoF Expiry:	05 Sep 2027	Odometer:	177,227 Kms
Good No.:	28406153	VIN:	MMU148LK0KH653622
Next Service:	187000 kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

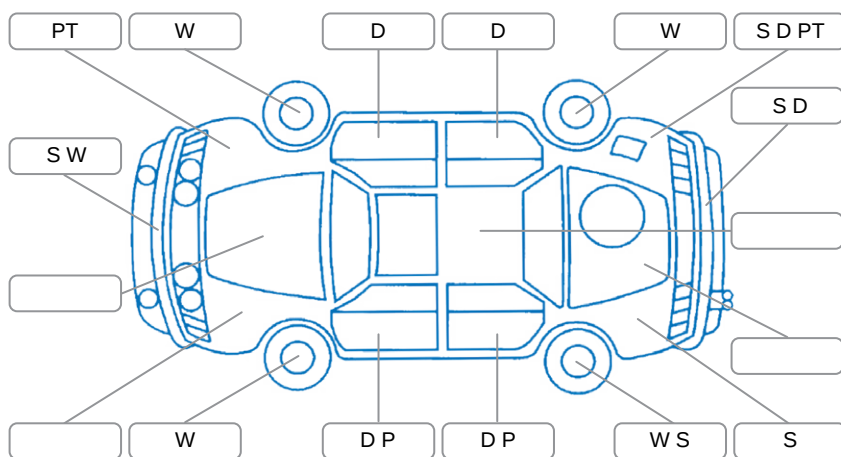

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Rear bumper pushed in RHS. Tailgate left support strap bolt bent. Rear of cab rust, under rear windscreen.
Right taillight missing black surround.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Front brake pads low

Interior Comments

Seats:	Average
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Driver seatbelt striker damaged.
Rear centre seatbelt jammed.
Front park lights not working. Right headlight DRL not working.
Shuddering while accelerating 70km/h+. Feels like misfire at higher speeds.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☐ Yes ☒ No Kms
Inspected by:	Eleoit Kumar
Published by:	Sam Huang
Inspection Date:	18 Aug 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation		✓	
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			8 mm
Right front			8 mm
Left rear			5 mm
Right rear			5 mm
Spare		N/A	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)	✓		
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____