

Report ID:	28,408,760	Version:	2
Created:	01 Sep 2026		


Make:	Nissan	Model:	Latio
Body Style:	Sedan	Year:	2014
Rego No.:	MGC529	Rego Expiry:	01 Jun 2024
WoF Expiry:	06 Feb 2027	Odometer:	114,702 Kms
Good No.:	28408760	VIN:	7AT0DH90X19011853
Next Service:	0	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

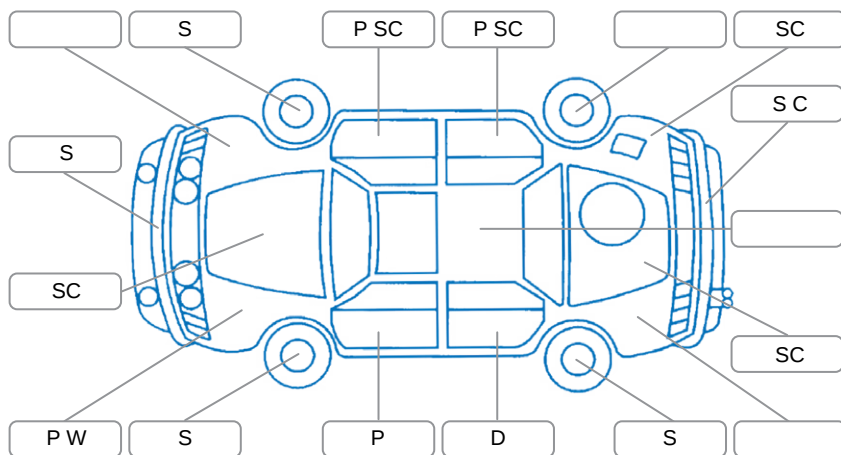

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

RR taillight cracked. Headlights faded.
Boot lid panel beginning to rust.
Boot area by spare wheel filled with water and rust.
Windscreen chipped inside cva.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Under bonnet starting to rust. Underbody rust front and rear. Both front rotors corroded.
LF and RF suspension lower arm bushes perishing.
Handbrake adjustment required.
All tyre pressures low.

Interior Comments

Seats:	Good
Carpets:	cargo area bad water damage.
Panels:	Good
Dashboard:	Good

General Comments

Centre right air vent damaged.
Radio volume and station dials are faulty.
****Please note: This vehicle is certified under a Certificate of Fitness (CoF), not a Warrant of Fitness (WoF)****

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Sharnae Smith
Published by:	Erin White
Inspection Date:	19 Aug 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake		✓	
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			4.0 mm
Left rear			3.0 mm
Right rear			3.0 mm
Spare		Yes	
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____