

Report ID:	28,425,855	Version:	1
Created:	05 Sep 2026		


Make:	Mercedes-Benz	Model:	Vito
Body Style:	Van	Year:	2015
Rego No.:	HYT97	Rego Expiry:	04 Nov 2026
WoF Expiry:	17 Jul 2027	Odometer:	155,081 Kms
Good No.:	28425855	VIN:	WDF63960323792990
Next Service:	159,000 km	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

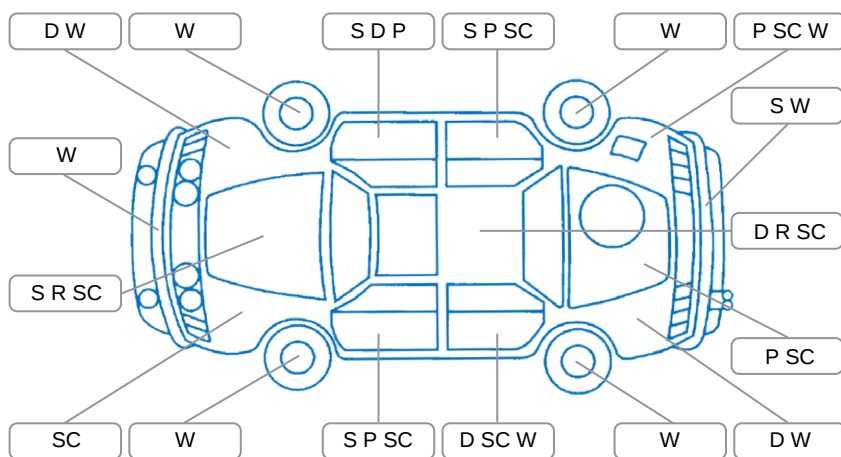

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Moisture in R/F tail light
R/F wing mirror damaged, R/R tail light cracked, L/R tail light has hairline cracks.
L/R quarter mould missing, L/R door handle damaged.
Windscreen crack/chip inside & outside of cva.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Rear wheel drive.
Oil residue underside.

Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Average
Dashboard:	Poor

General Comments

Rear wiper not working washer bottle cap missing.
Door glass switches faulty.
Interior cargo area scuffed dented.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Imraan Bryant
Published by:	Erin White
Inspection Date:	03 Sep 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			6.0 mm
Right front			6.0 mm
Left rear			6.0 mm
Right rear			6.0 mm
Spare		N/A	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____