

Report ID:	28,434,278	Version:	1
Created:	01 Sep 2026		


Make:	Mazda	Model:	Atenza
Body Style:	Sedan	Year:	2006
Rego No.:	LZR243	Rego Expiry:	15 Oct 2026
WoF Expiry:	07 Nov 2026	Odometer:	304,836 Kms
Good No.:	28434278	VIN:	7AT0C139X16400832
Next Service:	313,000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

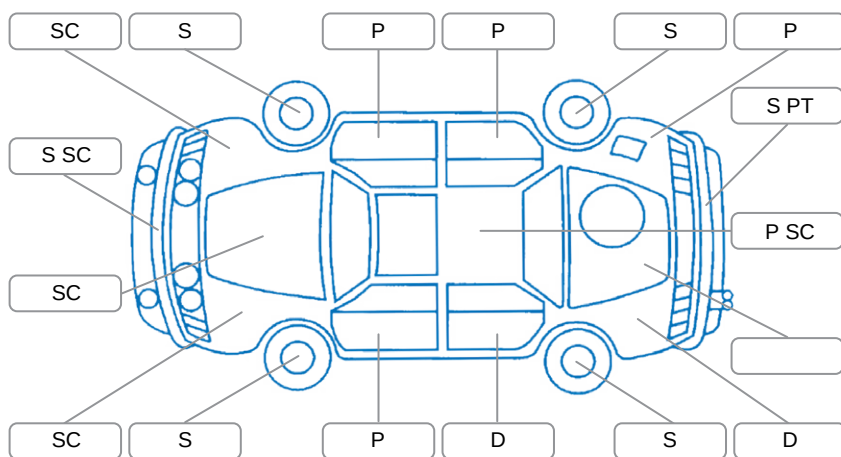

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Rear tail lights are tinted. Right rear monsoon shield broken.

Conditions During Body Inspection

Wet

Under Carriage and Under Bonnet Inspection Comments

Steering wheel controls not working.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Drivers kick panel missing.
Dashboard:	Good

General Comments

Jack is missing. Key light on dashboard. Factory radio not working. Rear wiper blade needs replacing. Both left windows not working on master switch. Oil leaks. Both rear tyres badly worn on the inside they need replacing. Loose wiring in boot. No lock nut for wheels. Vibration throughout drivetrain

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Lewis Dolamore
Published by:	Lewis Dolamore
Inspection Date:	01 Sep 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3 mm
Right front			3 mm
Left rear			2 mm
Right rear			3 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____