

Report ID:	28,451,304	Version:	2
Created:	08 Sep 2026		


Make:	LDV	Model:	T60
Body Style:	Utility	Year:	2019
Rego No.:	MBQ150	Rego Expiry:	28 Mar 2027
WoF Expiry:	27 Feb 2027	Odometer:	153,615 Kms
Good No.:	28451304	VIN:	LSFAM11A9HA104099
Next Service:	Unknown	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

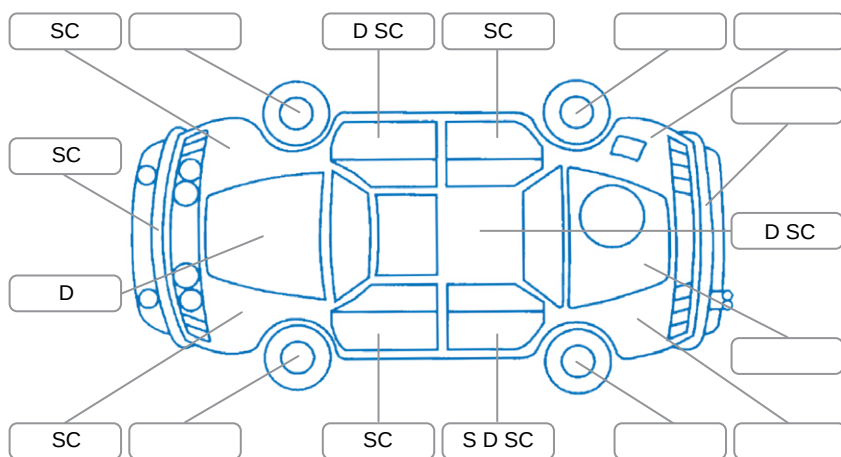

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

RF door seal torn.
Rust starting on RR and LF sill step plates.
Dents in RR cab corner.
Spare tyre tread low.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Coolant leak.
Both front driveshaft axle seals leaking.

Interior Comments

Seats: Good
Carpets: Poor, torn in drivers footwell.
Panels: Average
Dashboard: Average, steering wheel worn.

General Comments

LVVTA certified for raised suspension, plate located LF door jam. AC not cold. Clutch pedal rubber missing. Blind spot detection error appears intermittently when driving. Gear shifter is stiff to change gears and shifter boot loose. Aftermarket wiring under bonnet and in cabin, lights not working.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	☐ Yes	☐ No	Kms
Inspected by:	Troy Smith		
Published by:	Troy Smith		
Inspection Date:	08 Sep 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)		✓	
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	5.5 mm		
Right front	6.5 mm		
Left rear	3.5 mm		
Right rear	3 mm		
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____