

Report ID:	28,457,405	Version:	3
Created:	14 Sep 2026		


Make:	Ford	Model:	Fiesta
Body Style:	Hatchback	Year:	2009
Rego No.:	FCF710	Rego Expiry:	25 Jul 2027
WoF Expiry:	29 May 2027	Odometer:	228,017 Kms
Good No.:	28457405	VIN:	WF0JXXGAJJ9R22199
Next Service:	no record	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

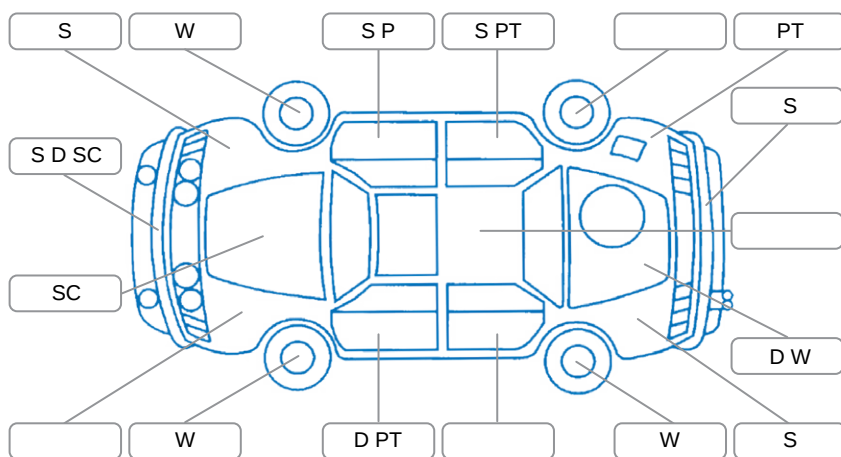

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Aerial is broken. Right side of bumper is not fitted correctly. Rear "fiesta" badge came off and secured in hand book. All tyres are noisy scalloped. Right door mirror rotator is loose. Stone chips in windshield.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Tow bar fitted for bike use only. Factory audio(including CD) had been removed and after market audio fitted. Steering control operate only volume. Radio doesn't pick up NZ frequency. Tools and jack are missing.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Yuki Itohara
Published by:	Yuki Itohara
Inspection Date:	14 Sep 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			2 mm
Right front			2 mm
Left rear			4.5 mm
Right rear			5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____