

|            |             |          |   |
|------------|-------------|----------|---|
| Report ID: | 28,458,821  | Version: | 3 |
| Created:   | 18 Sep 2026 |          |   |


|               |             |                  |                   |
|---------------|-------------|------------------|-------------------|
| Make:         | Ford        | Model:           | Transit           |
| Body Style:   | Van         | Year:            | 2019              |
| Rego No.:     | MGE581      | Rego Expiry:     | 14 Jan 2027       |
| WoF Expiry:   | 21 Jul 2027 | Odometer:        | 200,081 Kms       |
| Good No.:     | 28458821    | VIN:             | WF0YXXTTGYJG00803 |
| Next Service: | 219000 kms  | Service History: | Yes               |

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key

S = Scratch R = Rust C = Crack \* = Decals W = Significant scuffs  
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

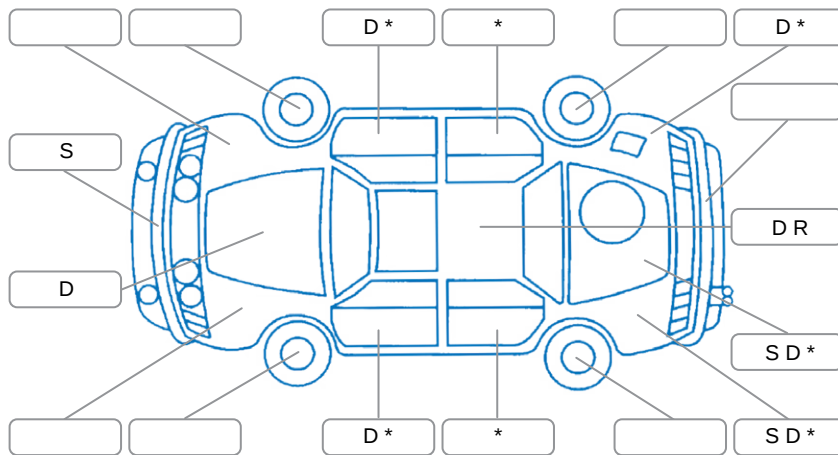

Note: some defects and blemishes may not be displayed in the diagram

## Body Inspection Comments

Interior rear chassis rust, engine oil leak, front brake rotor low, both rear bump stop torn, transmission oil leak, left sill dent, right sill dent, steering noise.

Conditions During Body Inspection Wet

## Under Carriage and Under Bonnet Inspection Comments

## Interior Comments

|            |         |
|------------|---------|
| Seats:     | Average |
| Carpets:   | Average |
| Panels:    | Average |
| Dashboard: | Good    |

## General Comments

Windscreen cva chip, dashboard speedo screen cracked,

|                                   |                                                                         |
|-----------------------------------|-------------------------------------------------------------------------|
| Road Conditions During Test Drive | Dry                                                                     |
| Engine Timing Mechanism           | Cambelt                                                                 |
| Evidence of Cam Belt Replacement  | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Kms |
| Inspected by:                     | Marlon Espena                                                           |
| Published by:                     | Marlon Espena                                                           |
| Inspection Date:                  | 18 Sep 2026                                                             |

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_

|                                                     | OK | Requires Attention | N/A  |
|-----------------------------------------------------|----|--------------------|------|
| <b>Engine</b>                                       |    |                    |      |
| Oil level                                           | ✓  |                    |      |
| Smoke & fumes                                       | ✓  |                    |      |
| Engine performance                                  | ✓  |                    |      |
| Noise                                               | ✓  |                    |      |
| Coolant condition                                   | ✓  |                    |      |
| Cooling performance                                 | ✓  |                    |      |
| Radiator / Hoses (visual)                           | ✓  |                    |      |
| <b>Transmission</b>                                 |    |                    |      |
| Operation                                           | ✓  |                    |      |
| Noise                                               | ✓  |                    |      |
| Clutch                                              |    |                    | ✓    |
| CV joints                                           | ✓  |                    |      |
| Wheel bearings                                      | ✓  |                    |      |
| <b>Brakes</b>                                       |    |                    |      |
| Performance                                         |    | ✓                  |      |
| Hand brake                                          | ✓  |                    |      |
| <b>Tyres (lowest observed tread depth of tyres)</b> |    |                    |      |
| Left front                                          |    |                    | 6 mm |
| Right front                                         |    |                    | 6 mm |
| Left rear                                           |    |                    | 8 mm |
| Right rear                                          |    |                    | 8 mm |
| Spare                                               |    | Yes                |      |
| <b>Suspension</b>                                   |    |                    |      |
| Suspension performance                              | ✓  |                    |      |
| Steering performance                                | ✓  |                    |      |
| Shock absorbers                                     | ✓  |                    |      |
| <b>Air Conditioning / Heater</b>                    |    |                    |      |
| Operation                                           | ✓  |                    |      |
| <b>Electrical / Accessories</b>                     |    |                    |      |
| Head lights                                         | ✓  |                    |      |
| Tail lights                                         | ✓  |                    |      |
| Indicators                                          | ✓  |                    |      |
| Dashboard warning lights                            | ✓  |                    |      |
| Wipers (front & rear)                               | ✓  |                    |      |
| Window winder FL                                    | ✓  |                    |      |
| Window winder FR                                    | ✓  |                    |      |
| Window winder RL                                    |    |                    | ✓    |
| Window winder RR                                    |    |                    | ✓    |
| Rear view mirrors                                   | ✓  |                    |      |
| Radio (basic test only)                             | ✓  |                    |      |
| CD (basic test only)                                |    |                    | ✓    |
| Number of keys                                      | 2  |                    |      |
| Central locking                                     | ✓  |                    |      |
| Remote locking                                      | ✓  |                    |      |
| Sat. nav. (basic test only)                         | ✓  |                    |      |
| Reversing camera                                    | ✓  |                    |      |