

Report ID:	28,459,364	Version:	2
Created:	10 Sep 2026		


Make:	Holden	Model:	Commodore
Body Style:	Wagon	Year:	2020
Rego No.:	MSR396	Rego Expiry:	01 Mar 2027
WoF Expiry:	06 Mar 2027	Odometer:	207,114 Kms
Good No.:	28459364	VIN:	W0VZM8EC7L1008811
Next Service:	221,000 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

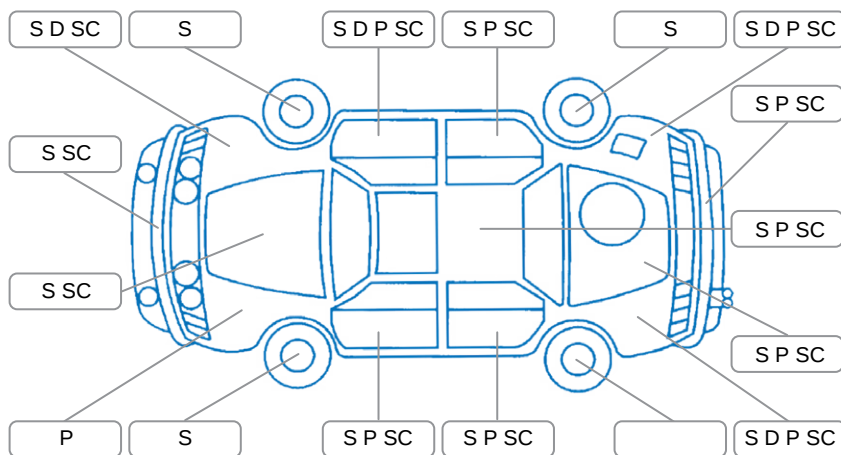

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Holes drilled in front and rear bumpers. RF door seal torn.
2 additional aerial ports and cut electrical harness on roof.
Front bumper lower RH moulding missing. Dent in LH sill.
Drivers door check strap clicking. Both side mirrors scuffed. Stonechips in windscreen.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Engine oil sump dented and scraped.
LF inner guard liner damaged.
Rear brake rotors worn.

Interior Comments

Seats:	Good
Carpets:	Average, holes drilled in passenger footwell.
Panels:	Average, holes drilled, boot floor modified.
Dashboard:	Poor, holes drilled in dash, steering wheel worn.

General Comments

Drivers seatbelt fraying.
Service park assist error appears intermittently when reversing.

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Troy Smith
Published by:	Troy Smith
Inspection Date:	10 Sep 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.5 mm
Right front			4.5 mm
Left rear			3.5 mm
Right rear			4 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____