

Report ID:	28,465,703	Version:	1
Created:	14 Sep 2026		


Make:	Hyundai	Model:	Iload
Body Style:	Van	Year:	2019
Rego No.:	MBP954	Rego Expiry:	27 Sep 2026
WoF Expiry:	29 Aug 2026	Odometer:	256,867 Kms
Good No.:	28465703	VIN:	KMFWBX7KLKU056004
Next Service:	259500	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

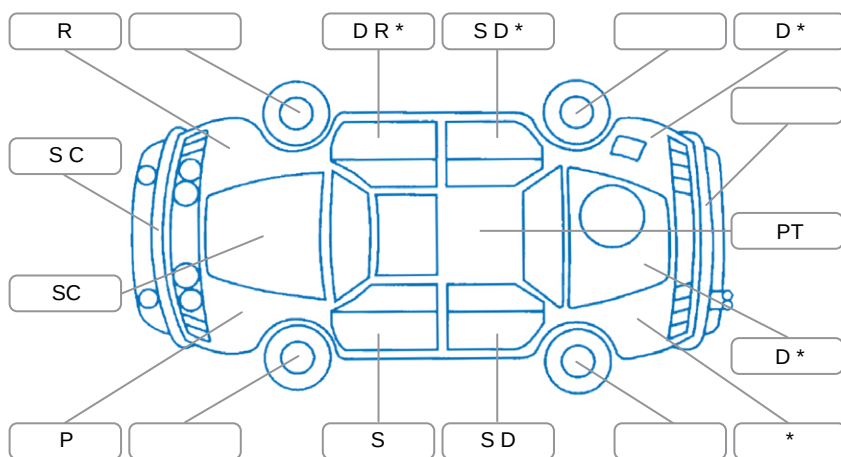

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Windscreen crack inside cva, both headlights moisture, FR seatbelt frayed, FR seat and carpet torn, FR door seal torn, R bull bar dent, TG badge missing, RB needs to refit, FL seatbelt damage, FB damage, FL inner guard damage,

Conditions During Body Inspection	Wet
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Engine oil leak,

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Curshey Accad
Published by:	Curshey Accad
Inspection Date:	14 Sep 2026

I have read and understood this condition guide:

NAME _____

SIGNATURE _____

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			8 mm
Right front			8 mm
Left rear			6 mm
Right rear			6 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		