

Report ID:	28,469,978	Version:	3
Created:	23 Sep 2026		


Make:	Mazda	Model:	E1800
Body Style:	Van	Year:	2004
Rego No.:	CDE550	Rego Expiry:	05 Jul 2027
WoF Expiry:	15 May 2027	Odometer:	209,197 Kms
Good No.:	28469978	VIN:	JM0SKW08200301937
Next Service:	218,100 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

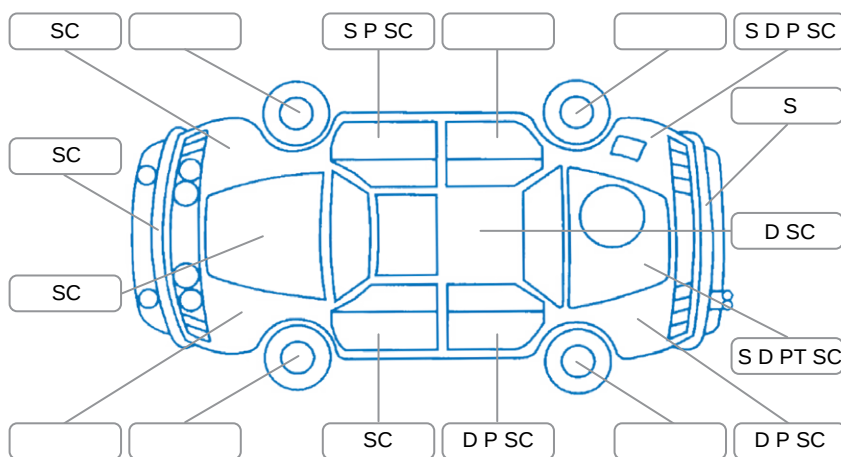

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Crack in LF indicator. Dent in RH cant rail.
Cracks in RH taillight. Rear wiper arm has been removed.
RF wheel arch/step plate worn.
RF door clicks when opening.

Conditions During Body Inspection

Under Carriage and Under Bonnet Inspection Comments

Engine oil leaks.

Interior Comments

Seats: Average, drivers seat base torn.
Carpets: Average
Panels: Average
Dashboard: Average, steering wheel worn.

General Comments

Battery test indicates bad and replace, SOH 56% SOC 77% IR 11.4 mΩ.
Drivers seat back adjustment handle broken. Brake pedal pulsating.
Rear window washer not spraying.
Intermittent grinding noise in driveline when moving off.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Cambelt		
Evidence of Cam Belt Replacement	☒ Yes	☐ No	166,107 Kms
Inspected by:	Troy Smith		
Published by:	Troy Smith		
Inspection Date:	23 Sep 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			7.5 mm
Right front			8.0 mm
Left rear			5.5 mm
Right rear			5.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____