

Report ID:	28,479,137	Version:	1
Created:	20 Sep 2026		


Make:	Volkswagen	Model:	Polo
Body Style:	Hatchback	Year:	2007
Rego No.:	JKA162	Rego Expiry:	05 Apr 2027
WoF Expiry:	16 Sep 2027	Odometer:	114,666 Kms
Good No.:	28479137	VIN:	WVWZZZ9NZ8U003709
Next Service:	120,000 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

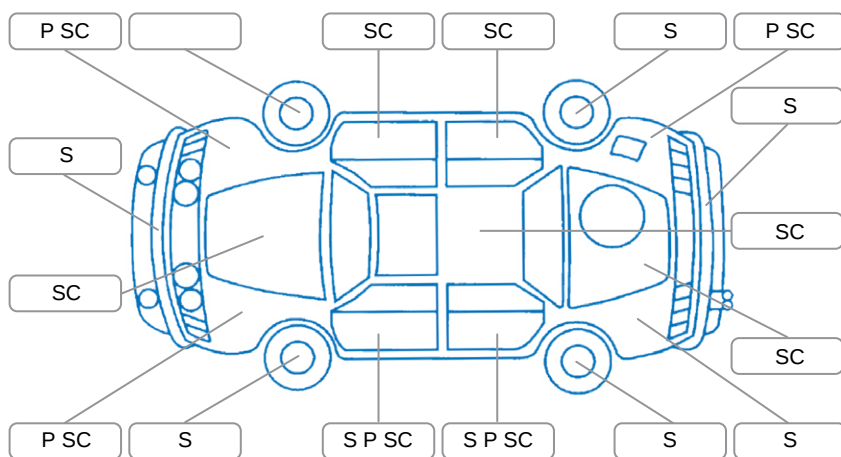

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

RF wheel trim missing. LR wheel trim missing logo.
Paint defect on RH side mirror.
Aerial is in poor condition.
LH side mirror damaged, indicator repeater cracked.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Good
Carpets:	Good, FL floor mat missing.
Panels:	Average, door card fabrics sagging.
Dashboard:	Poor, dash cracking.

General Comments

Engine is noisy when cold.
FL window washer needs adjusted. Rear wiper blade needs replaced.
Central locking not working on RR door.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☐ Yes ☒ No Kms
Inspected by:	Troy Smith
Published by:	Troy Smith
Inspection Date:	20 Sep 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise		✓	
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3 mm
Right front			4.5 mm
Left rear			5.5 mm
Right rear			5.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking		✓	
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____