

Report ID:	28,498,334	Version:	1
Created:	29 Sep 2026		


Make:	Volkswagen	Model:	Crafter
Body Style:	Van	Year:	2020
Rego No.:	NAY180	Rego Expiry:	07 Sep 2026
WoF Expiry:	06 Sep 2026	Odometer:	265,084 Kms
Good No.:	28498334	VIN:	WV1ZZZSYZL9034560
Next Service:	273318 kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

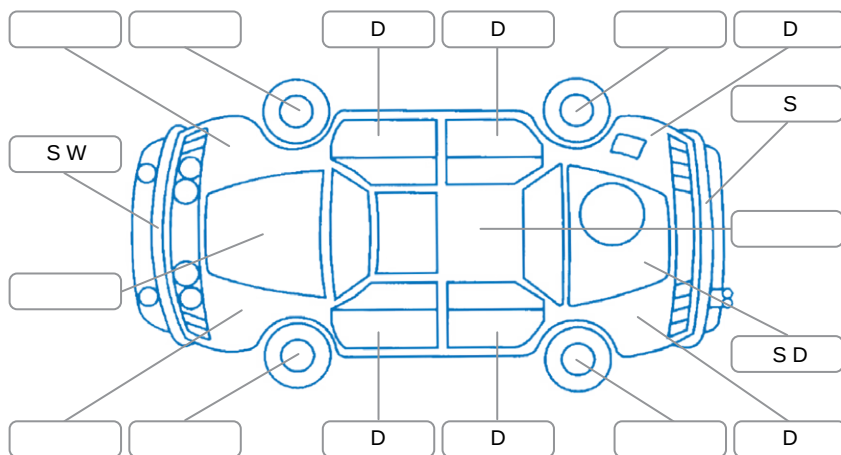

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Driver seatbelt beginning to fray. Steering wheel wear. RF tyre inside edge wear. Rear tyres nail punctures. Unable to see roof for damage.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Engine oil leaks. Steering rack oil stains. Front outer CV boots split and grease leaks. Front and rear brake pads low and rotors lipped.

Interior Comments

Seats:	driver seat tear
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Check engine light on. Brake pad warning message on dash. 1 remote key blade broken. W/S stone chip in CVA. Overdue for cambelt replacement.
11 FAULT CODES (further investigation required).

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☐ Yes ☒ No Kms
Inspected by:	Eleoit Kumar
Published by:	Eleoit Kumar
Inspection Date:	29 Sep 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints		✓	
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5 mm
Right front			5 mm
Left rear			5 mm
Right rear			5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____