

Report ID:	28,505,955	Version:	2
Created:	06 Oct 2026		


Make:	Holden	Model:	Cruze
Body Style:	Hatchback	Year:	2016
Rego No.:	JYJ992	Rego Expiry:	05 Jan 2027
WoF Expiry:	19 Jun 2027	Odometer:	150,266 Kms
Good No.:	28505955	VIN:	6G1PD6EM9GL217102
Next Service:	157,173 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

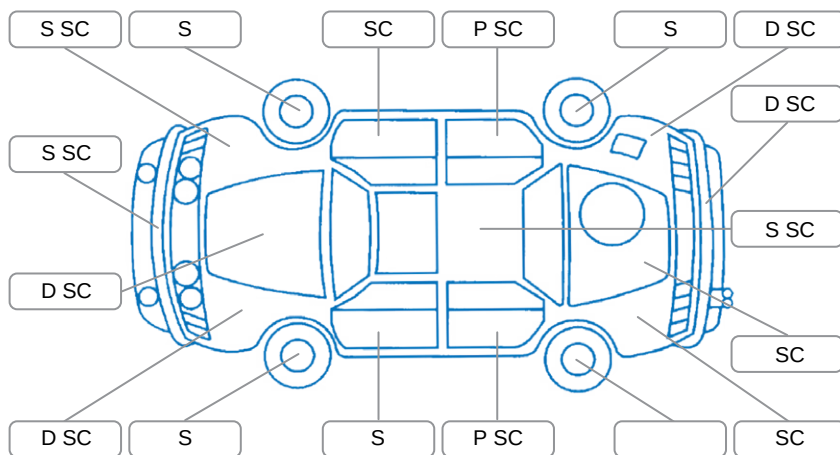

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Both front tyres need replaced.
Bottom of LF guard dented.
Dent in LH sill.
Rear tyres are wearing unevenly on inside edge, noisy.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Sticker under bonnet reads next cambelt due at 207,300 Kms.
Engine oil leaks.
Coolant leaks.

Interior Comments

Seats: Good
Carpets: Good
Panels: Good. Passenger sunvisor mirror cover missing.
Dashboard: Average, steering wheel worn.

General Comments

LR and centre rear seats headrests missing.
Check engine light on. Traction control warning light comes on intermittently .
Rear wiper blade needs replaced.
One key remote in poor condition and has a button missing.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Cambelt		
Evidence of Cam Belt Replacement	☒ Yes	☐ No	Kms
Inspected by:	Troy Smith		
Published by:	Shanna Bullion		
Inspection Date:	04 Oct 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)		✓	
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	1.5 mm		
Right front	1.5 mm		
Left rear	3.0 mm		
Right rear	3.5 mm		
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____