

Report ID:	28,507,136	Version:	2
Created:	05 Oct 2026		


Make:	Mazda	Model:	Bt-50
Body Style:	Utility	Year:	2017
Rego No.:	LCH218	Rego Expiry:	07 Dec 2026
WoF Expiry:	22 Dec 2026	Odometer:	178,748 Kms
Good No.:	28507136	VIN:	MM0UR0YG100791131
Next Service:	181,015 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

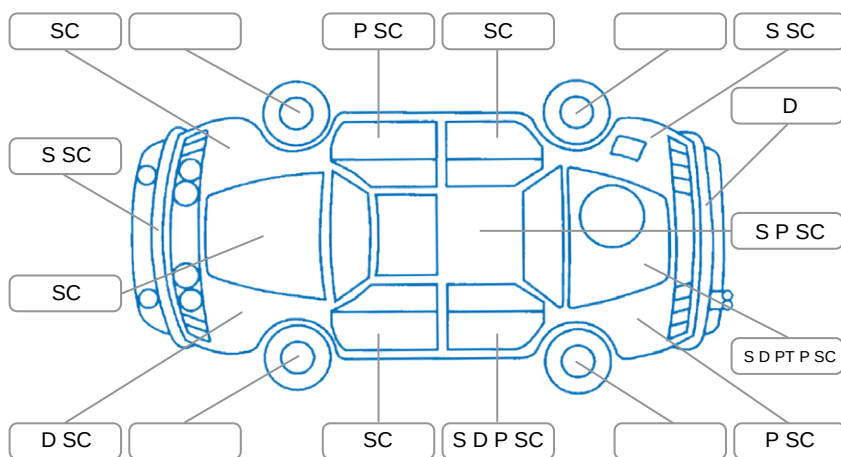

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Front bumper fits poorly on sides. LF wheel centre cap missing.
LF, RF, and RR sill step plates worn. LR mudflap missing.
RH rear reflector/reverse light cracked. Rear bumper is pushed in.
Rust bubbling on LH A pillar on windscreen edge.

Conditions During Body Inspection

Under Carriage and Under Bonnet Inspection Comments

Engine cover missing.
Exhaust sensor wiring has been tampered with, sensor forward of DPF is unplugged and female connector removed.

Interior Comments

Seats: Average, minor tear in drivers seat base.
Carpets: Good
Panels: Average
Dashboard: Good, steering wheel wearing.

General Comments

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	☐ Yes	☐ No	Kms
Inspected by:	Troy Smith		
Published by:	Troy Smith		
Inspection Date:	05 Oct 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			7 mm
Right front			6.5 mm
Left rear			7 mm
Right rear			7.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____