

Report ID:	28,525,225	Version:	1
Created:	12 Oct 2026		


Make:	Mazda	Model:	Atenza
Body Style:	Wagon	Year:	2005
Rego No.:	FTK524	Rego Expiry:	31 Jul 2027
WoF Expiry:	05 May 2027	Odometer:	280,217 Kms
Good No.:	28525225	VIN:	7AT0C139X10503281
Next Service:	Unknown.	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

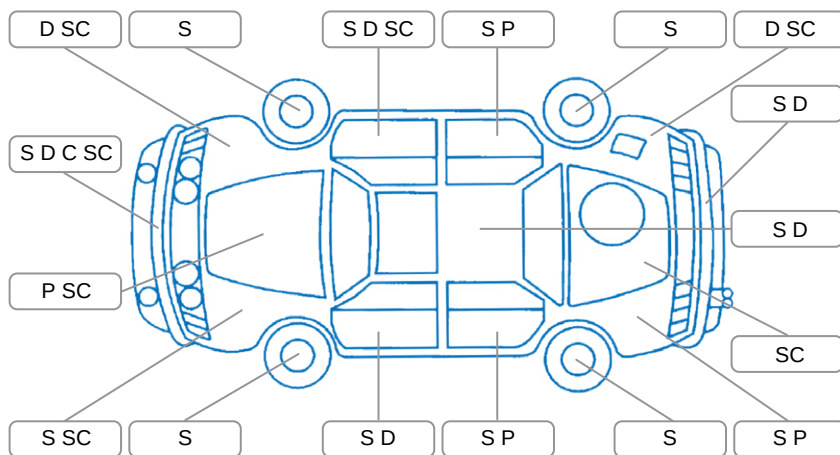

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Front grill broken and needs refit
Front left wheel arch missing.
Left sill dented.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Both inner CV boot's split.
Both steering rack boots split.
Oil leak.

Interior Comments

Seats: Average
Carpets: Average
Panels: Average
Dashboard: Average

General Comments

2WD. A/C not pushing cold air.
Left high beam out. Rear window winders work intermittently.
Right front wiper blade needs replaced. Remote half of key missing.
Engine light on. Radio cannot find signal. Boot mat stained.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	☐ Yes	☐ No	Kms
Inspected by:	Flynn Burdon		
Published by:	Jason Bucksey		
Inspection Date:	12 Oct 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.9 mm
Right front			5.8 mm
Left rear			6.8 mm
Right rear			6.7 mm
Spare		No	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL		✓	
Window winder RR		✓	
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____