

Report ID:	28,525,336	Version:	1
Created:	12 Oct 2026		


Make:	Subaru	Model:	Legacy
Body Style:	Wagon	Year:	2006
Rego No.:	MAD975	Rego Expiry:	06 Apr 2027
WoF Expiry:	13 Mar 2027	Odometer:	191,674 Kms
Good No.:	28525336	VIN:	7AT0GF0BX18027946
Next Service:	195,698km's	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

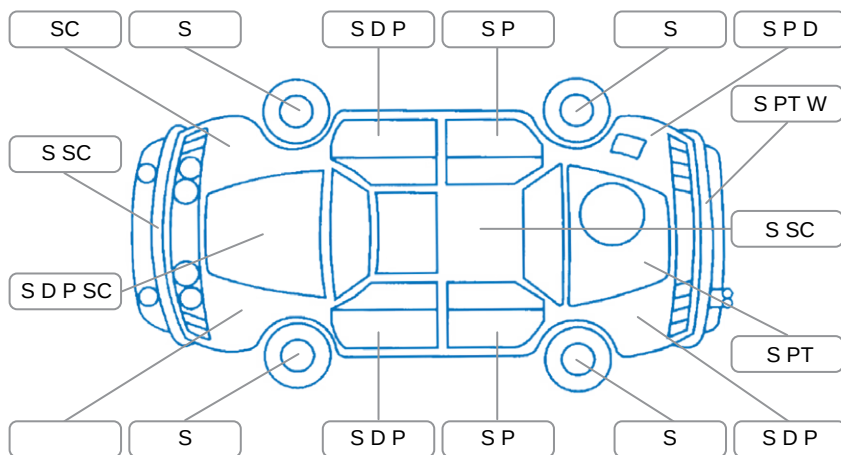

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Crack in right side wing mirror indicator repeater lens. Inside & outside edges worn very low on left front tyre, also cracks on inner side wall of tyre & a cut on side wall on outside of tyre.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Oil leaks from engine. Left inner cv boot is split.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Knocking from front suspension, suspension has been lowered so very hard riding. Hole worn in fabric on base pad of driver's seat. Cracking across both sides of dashboard. Hole in carpet in right front foot well area.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Jason Young
Published by:	Glen Charlton
Inspection Date:	12 Oct 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			2.0 mm
Right front			4.2 mm
Left rear			5.2 mm
Right rear			5.2 mm
Spare		Yes	
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____