

Report ID:	28,527,750	Version:	1
Created:	13 Oct 2026		


Make:	Subaru	Model:	Impreza
Body Style:	Hatchback	Year:	2010
Rego No.:	KFN502	Rego Expiry:	30 Nov 2026
WoF Expiry:	05 Nov 2026	Odometer:	158,331 Kms
Good No.:	28527750	VIN:	7AT0GF09X16004486
Next Service:	167000 Kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

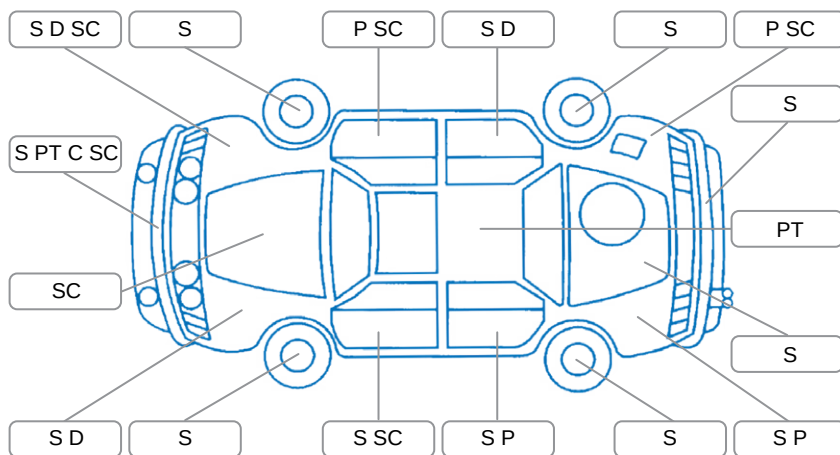

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Front right bumper corner plastic trim missing. Minor stone chips in windscreen.
Both sills scratched.
Front bumper does not sit flush.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Oil leaks.
Hole has been cut in skid cover.
Left steering rack boot leaking.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

4WD. Front window washer jets not shooting water.
A/C not pushing cold air. Only one key locks and unlocks vehicle.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☐ Yes ☒ No Kms
Inspected by:	Flynn Burdon
Published by:	Grant Markham
Inspection Date:	13 Oct 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.7 mm
Right front			5.3 mm
Left rear			7.0 mm
Right rear			6.8 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____